


Note: Found point information

- A. Found S65°28'57"W, 0.73' from calculated point
- B. Found S61°10'57"W, 0.85' from calculated point
- C. Found N39°40'57"W, 8.03' from calculated point
- D. Found N14°04'32W, 11.98' from calculated point
- E. Found 26°30'20"E, 3.81' from calculated point

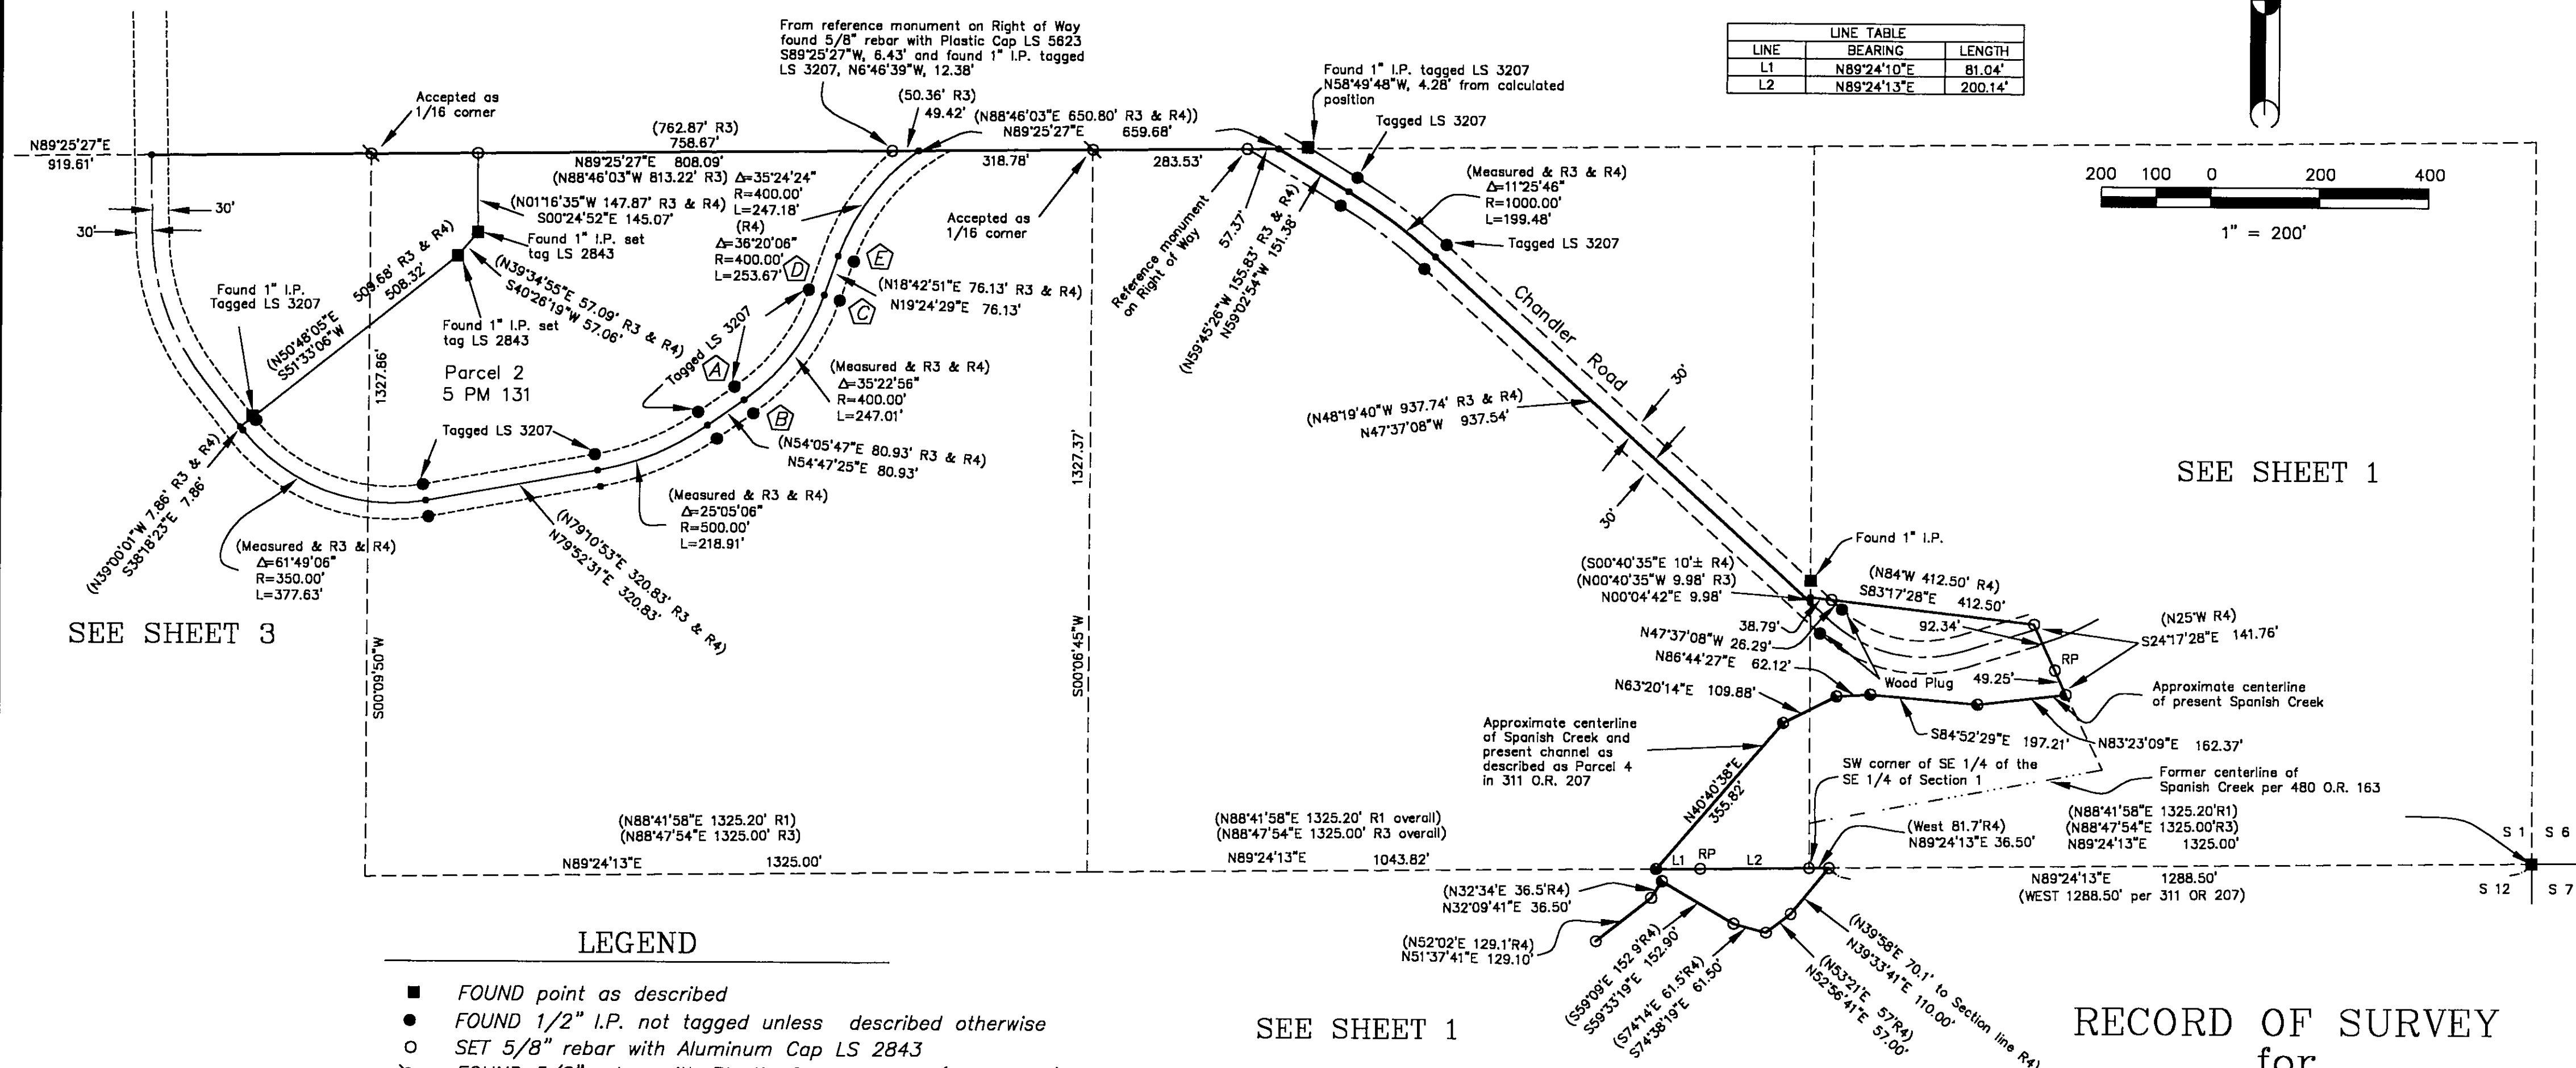

LINE TABLE		
LINE	BEARING	LENGTH
L1	N89°24'10"E	81.04
L2	N89°24'13"E	200.14

200 100 0 200 400

1" = 200'

SEE SHEET 1

SEE SHEET 3

LEGEND

- FOUND point as described
 - FOUND 1/2" I.P. not tagged unless described otherwise
 - SET 5/8" rebar with Aluminum Cap LS 2843
 - ✕ FOUND 5/8" rebar with Plastic Cap LS 5623 (No Record)
 - Nothing Set corner falls in Spanish Creek
 - Nothing Found or Set
- (R1) RECORD per 5 RS 18
- (R2) RECORD per 10 RS 116
- (R3) RECORD per 5 PM 131
- (R4) RECORD per 480 O.R. 163
- ① See corresponding Note for found point information

SEE SHEET 1

RECORD OF SURVEY
for

Tom Bengard

A portion of Sections 1, 2, 11 and 12

T. 24 N., R. 9 E., M.D.M.

Plumas County ~ California

Scale 1" = 200' February, 2003

Hamby Surveying Inc.
P.O. Box 1209
Portola, CA 96122
(530) 832-5571

SHEET 2 OF 4

02246rs2

13 RS 2