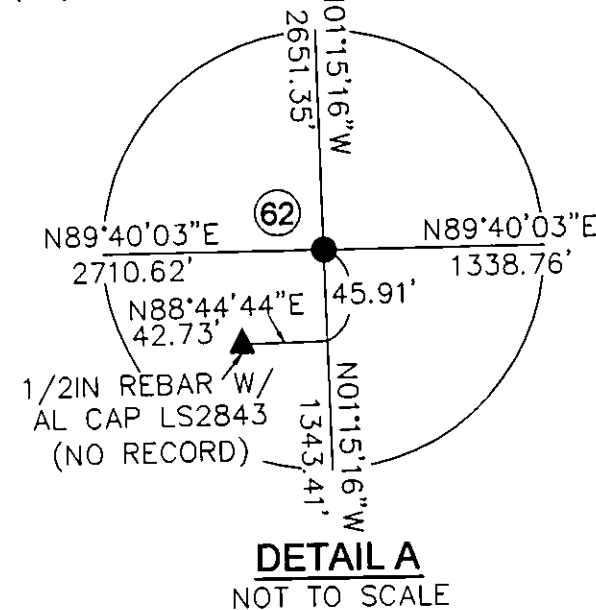


A STANDARD BUREAU OF LAND MANAGEMENT (BLM) MONUMENT IS A 2-1/2" DIAMETER STEEL PIPE, 28" LONG WITH A 3-1/2" BRASS CAP EDGE-MARKED WITH THE BLM LOGO.

R1 GOVERNMENT LAND OFFICE NOTES (GLO)
1881 D.C. HALL

R9 DEPENDENT SURVEY, BLM 1983 HAMILTON

	FOUND BLM CORNER
	FOUND USFS CORNER
	CORNERS CALCULATED
	FOUND LS CORNER
	CORNER NOTE
	SET STANDARD U.S. FOREST SERVICE DRIVE-IN MONUMENT (BEARING TREES AS NOTED)
	PROPERTY BOUNDARY MARKED AND POSTED
AL	ALUMINUM

STATE PLANE COORDINATES CALIFORNIA - ZONE 1 1983		
0 AT THE CN 1/16 CORNER OF SECTION 14 T22N, R12E = 00°52'32"		
CORNER #	NORTHING	EASTING
63	1821219.663	6941907.851
56	1821192.089	6944648.981
57	1821234.862	6947322.669
58	1818556.919	6947384.504
61	1818549.148	6946045.762
62	1818541.378	6944707.020
66	1818525.642	6941996.446
59	1817198.293	6944736.428
60	1817208.120	6946075.925
53	1815878.975	6947446.339
55	1815855.208	6944765.836
64	1815831.618	6942085.045

MULTIPLY MEASURED DISTANCES BY
1.000064869 TO GET GROUND DISTANCES

RONALD
GREENWELL
& ASSOCIATES INC.

10 S. LAKE DRIVE, SUITE 1
ANTIOCH, CA 94509-2057
(925) 778-0626

SECTION 33, T23N R12E, MDM,
PLUMAS COUNTY, CALIFORNIA

CREW
D. GREENWELL
B SNOW
P GOSS
C BURDICK

FOR
U.S.D.A. PLUMAS NATIONAL FOREST
P.O. BOX 11500, QUINCY, CA.

DRAWN BY: B HARTMAN DATE: JANUARY 3, 2006