


RAILROAD CURVE DATA RECORD OR CALC FROM 1992 BLM SURVEY & MEAS. EXCEPT AS NOTED

COURSE	DELTA OR BEARING	ARC LENGTH			RADIUS			RAILROAD STATIONING
		LT	CL	RT	LT	CL	RT	
A	12°55'54"		215.53		854.93	954.93		587+64.4
B	S18°08'11"W		100.00					tie to corner
C	4°59'47"	74.55	83.27		854.93	954.93		588+47.4 ($\Delta=4°58'54"$ L=83.03')A
D	6° spiral		200					590+47.4
E	N82°50'43"W	326.80	326.80					593+74.2
F	6° spiral		200					595+74.2
G	22°58'00"	422.86	382.80		1054.93	954.93		599+57.0
H	6° spiral		200					601+57.0
D1	N79°22'31"W		92.15		SPIRAL			CHORD
D2	N82°21'12"W		97.30		SPIRAL			CHORD
F1	N82°20'44"W		102.53		SPIRAL			CHORD
F2	N79°19'45"W		107.86		SPIRAL			CHORD
G1	6°37'42"		122.04		1054.93			
G2	16°20'19"		300.82		1054.93			
H1	N51°23'20"W		71.96		SPIRAL			CHORD
H2	N50°05'34"W		63.15		SPIRAL			CHORD
H3	N48°23'02"W		75.26		SPIRAL			CHORD
S	51°41'01"			153.35				170
S1	54°46'18"		191.19			200		
S2	57°23'21"	230.38			230			

NOTES ON FOUND CORNERS

1. Fd. 1/2" bar RCE 15265 per 7PM144 0.04S 1.81 W
2. Fd. 1/2" bar RCE 15265 per 7PM144 0.04N 2.86E
3. Fd. 1/2" bar RCE 15265 per 7PM144 0.25'S, 0.49'W
4. Fd. Witness corner per (A) brass cap on 2" I.D. Pipe S88°W 13.46'
5. Fd. 1-1/2" Pipe RCE 22148 per 7 RS98 S21°E 3.36'

- ⊕ Fd. BLM Monument per 1992 BLM Survey
 ○ Fd. as noted
 ● Set 1/2" rebar RCE 22836
 () A Record per BLM Survey 1992
 () B Record per 5 Maps 19 Rotated 0°42'05" CW to match B.O.B.
 () C Record per 5 maps, 78 Rotated 0°42'05" CW to match B.O.B.
 M Measured
 ● Fd. 1/2" Rebar RCE 22836 per ____ PM ____
 △ Calc Point
 B.O.B. Basis of Bearing

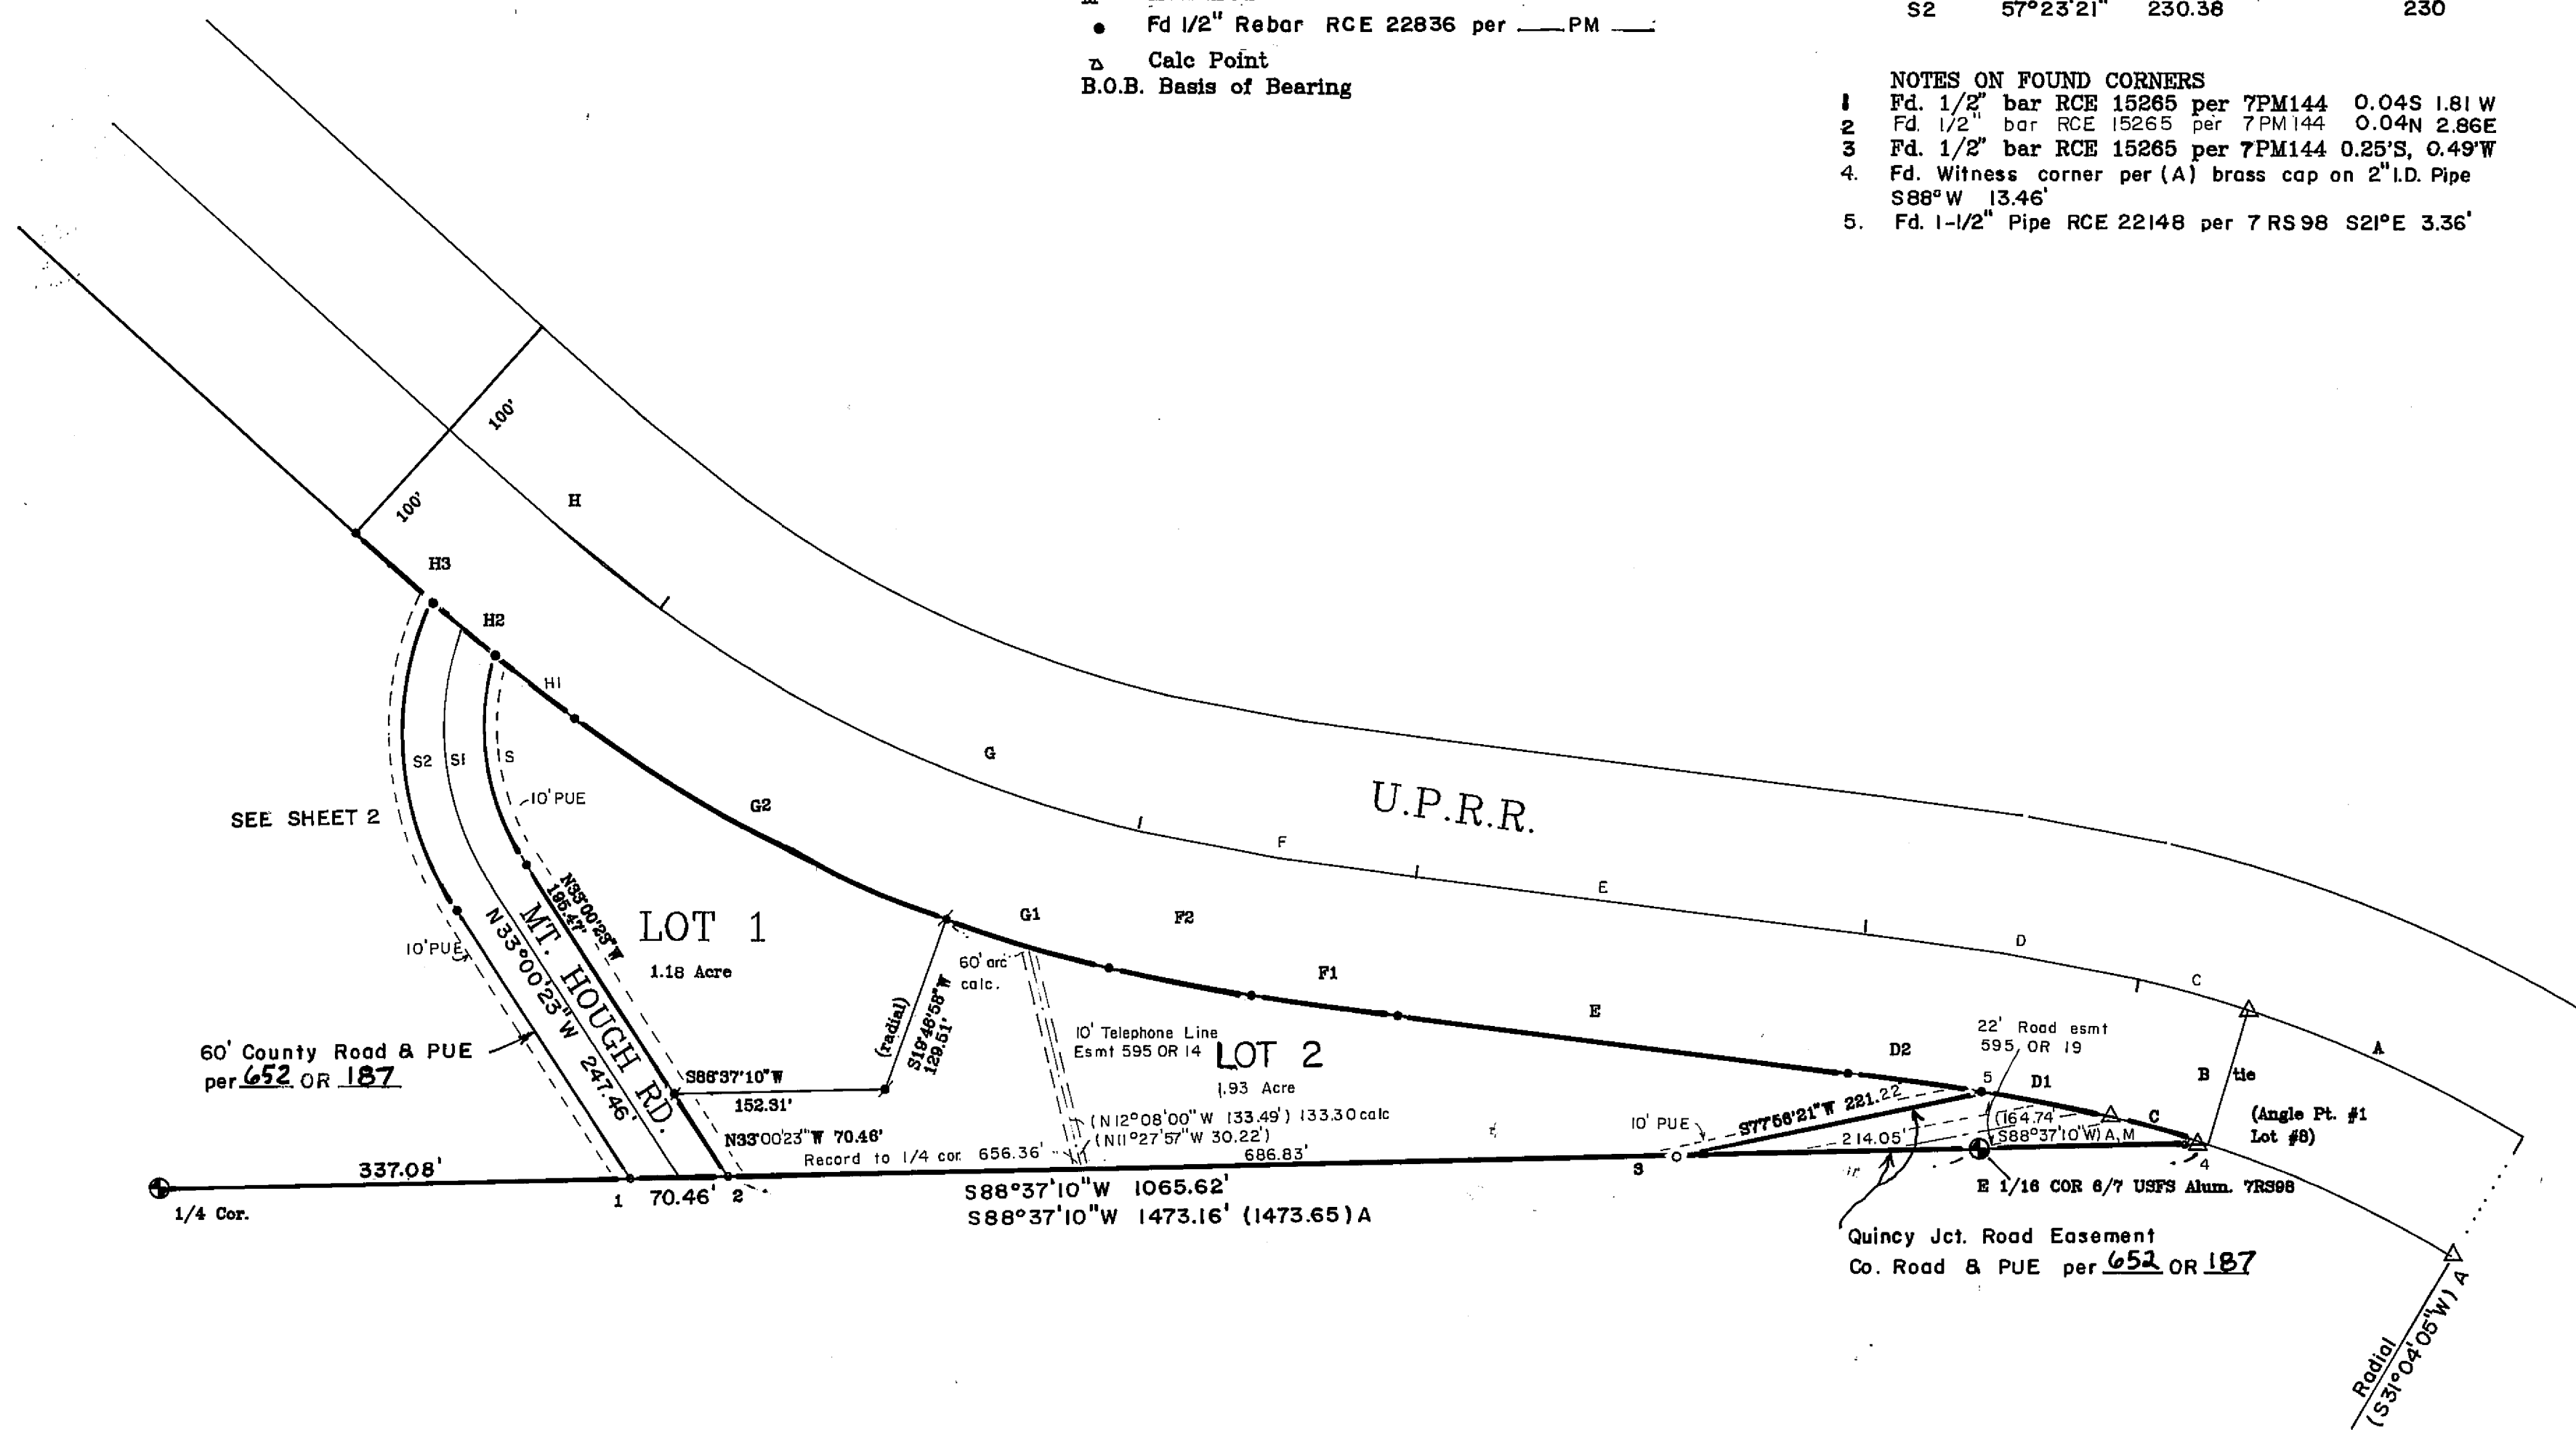

MT HOUGH ESTATES UNIT #2

A Subdivision of six lots within a portion of Sec 6-7, T24N, R10E, North of Quincy, Plumas Co., CA.

Owner: A. L. Hansen & Erika Hansen and McElroy Logging, Inc.
2570 Quincy Jct. Rd.
Quincy, CA 95971 283-4312

Engineer: Cliff Brown Engineering & Survey
2335 Ponderosa
Quincy, CA 95971 283-3959

January 1995

sheet 3 of 4