

CORNER NOTES

AP-1
SET AN ALUM. ROD 1/2" O.D.
36" LONG, FLUSH WITH GROUND
WITH 3/4" ALUM. CAP MKD.
AP-1
LS 5427
1984

AP-2
SET AN ALUM. ROD 1/2" O.D.
24" LONG, 21" IN GROUND
WITH 3/4" ALUM. CAP MKD.
AP-2
LS 5427
1984


AP-3
SET AN ALUM. ROD 1/2" O.D.
24" LONG, 21" IN GROUND
WITH 3/4" ALUM. CAP MKD.
AP-3
LS 5427
1984

AP-4
SET AN ALUM. ROD 1/2" O.D.
36" LONG, FLUSH WITH GROUND
WITH 3/4" ALUM. CAP MKD.
AP-4
LS 5427
1984

AP-5
SET AN ALUM. ROD 1/2" O.D.
24" LONG, FLUSH WITH GROUND
WITH 3/4" ALUM. CAP MKD.
AP-5
LS 5427
1984

AP-6
SET AN ALUM. ROD 1/2" O.D.
24" LONG, FLUSH WITH GROUND
WITH 3/4" ALUM. CAP MKD.
AP-6
LS 5427
1984

AP-7
SET AN ALUM. ROD 1/2" O.D.
24" LONG, 21" IN GROUND
WITH 3/4" ALUM. CAP MKD.
AP-7
LS 5427
1984

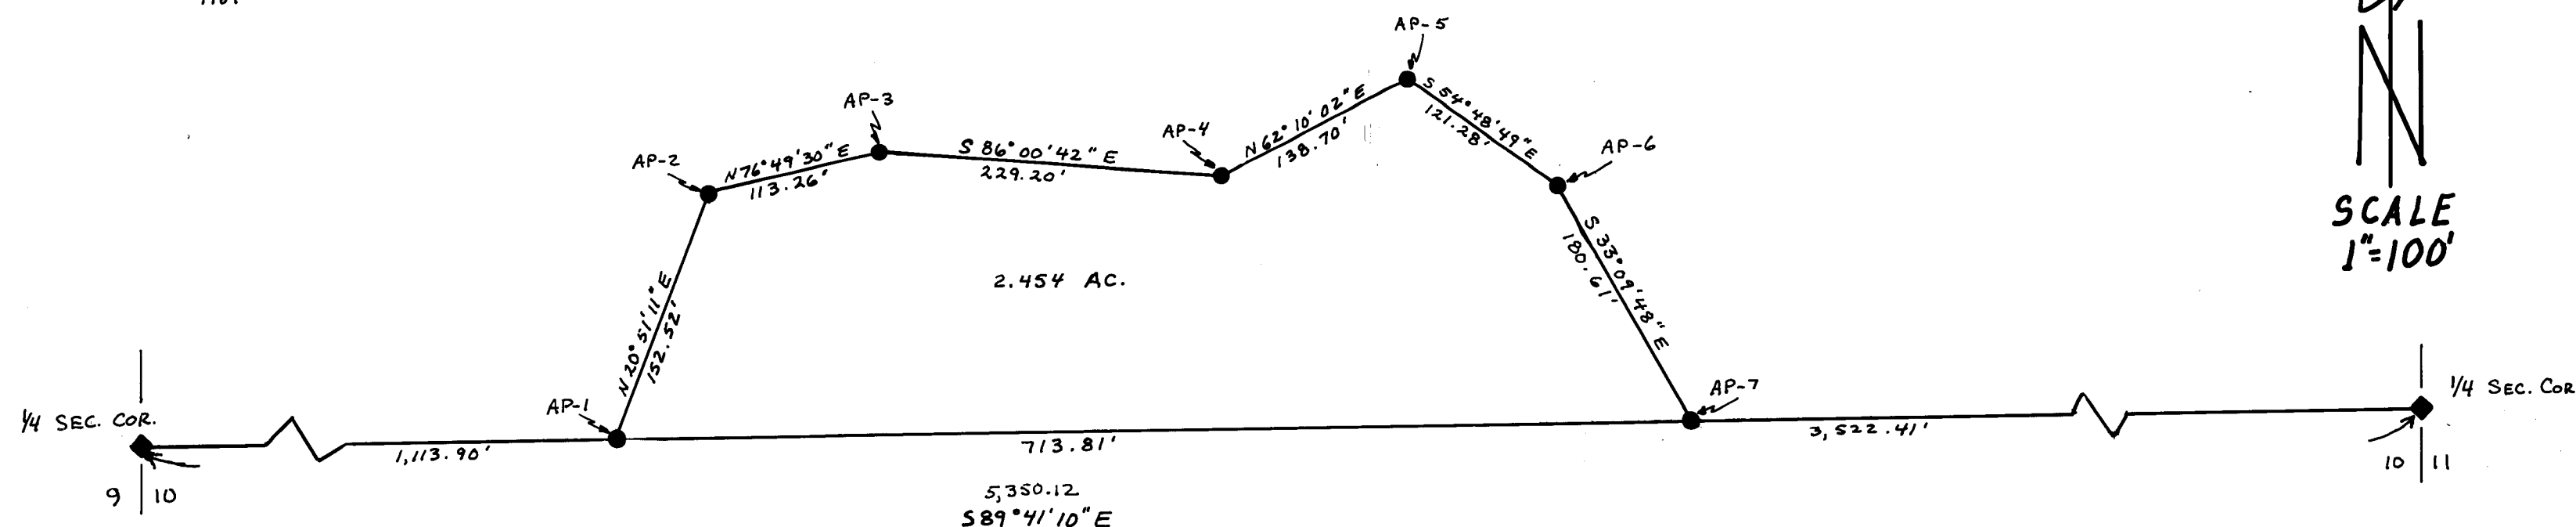

FOUND:
AN IRON PIPE 1" O.D. AND IN A M.O.S.
30" DIA. WITH A 2" BRASS CAP MKD.

JAB
RE
2435

ALSO FOUND A WOOD POST 32"X4"X4"
WITH SCRIBE MKS 1/4 S ON ONE SIDE,
IX ON ONE SIDE, AND X ON THE THIRD
SIDE (G.L.O. RECORD: CEDAR POST 48"X4"
MKD 1/4 S ON WEST SIDE)

SET:
AN ALUM. PIPE 2 1/2" DIA. 36" LONG, 28" IN
GROUND AND IN A M.O.S. 36" AT BASE TO TOP
OF A 3/4" STANDARD U.S.F.S. ALUM. CAP MKD.

T23N R10E
1/4
S9 S10
LS 5427
1984

FROM WHICH NEW BT'S
A WHITE FIR 23" DIA. BRS. S86 3/4"E 22.4 FT.
MKD. 1/4 S 10 BT
A WHITE FIR 13" DIA. BRS. S67 1/2"W 25.2 FT.
MKD. 1/4 S 9 BT
DEPOSITED LOCAL PIPE IN HOLE BELOW GROUND
AND WOOD POST ALONGSIDE M.O.S.

FOUND:
AN IRON PIPE 1" O.D. AND IN A M.O.S.
36" DIA. AT BASE 18" ABOVE GROUND
WITH TAG MKD. RE 2435, NOT OF
RECORD.

FROM WHICH ORIGINAL G.L.O. BT'S
A JEFFERY PINE 28" DIA. BRS. S45°29'W
13.2 FT. DIST. ILLEGIBLE SCRIBE MARKS
VISIBLE
(RECORD: S47°W 20 LKS DIST.)

A DOUGLAS FIR 35" DIA. BRS. S77°07'E
7.6 FT. DIST. WITH OVERGROWN FACE
(RECORD: S70°E 11 LKS DIST.)

SET:
AN ALUM. PIPE 2 1/2" DIA. 30" LONG
22" IN GROUND AND IN A M.O.S. 36"
AT BASE TO TOP OF A 3/4" STANDARD
U.S.F.S. ALUM. CAP MKD.

T23N R10E

1/4
S10 S11
LS 5427
1984

DEPOSITED LOCAL PIPE IN HOLE

BASIS OF BEARING

SOLAR OBSERVATION TAKEN
NEAR THE 1/4 SECTION CORNER
OF SECTIONS 10 & 11

LAT. = 39°52'10"
LONG. = 120°50'45"

LEGEND

- ◆ FOUND CORNER AS NOTED
- SET FOREST SERVICE MONUMENT
AS NOTED IN CORNER NOTES

RECORD OF SURVEY

A PORTION OF SECTION 10
T23N R10E M.D.B. & M.

COUNTY OF PLUMAS
STATE OF CALIFORNIA

FOR
U.S.D.A. - FOREST SERVICE
PLUMAS N.F.

M.L. ELDRIDGE - L.S. 5427 - JUNE 1984

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR
UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS
OF THE LAND SURVEYORS ACT AT THE REQUEST OF THE U.S.D.A. -
FOREST SERVICE, IN JUNE 1984

Michael L. Eldridge
MICHAEL L. ELDRIDGE
L.S. 5427

COUNTY SURVEYOR'S CERTIFICATE

THIS MAP HAS BEEN EXAMINED FOR CONFORMANCE WITH
THE REQUIREMENTS OF THE LAND SURVEYORS ACT THIS
2ND DAY OF November, 1984

Lawrence J. Brock
LAWRENCE J. BROCK
RCE 13528

RECORDER'S CERTIFICATE

FILED THIS 2ND DAY OF November, 1984 AT 1:15 P.M.
IN BOOK 7 OF RECORDS OF SURVEYS, AT PAGE 10, AT
THE REQUEST OF THE COUNTY ENGINEER.

FEE \$500
FILE # 3797

ILA 01665
COUNTY RECORDER
BY: [Signature]
DEPUTY

SHEET 1 OF 1