


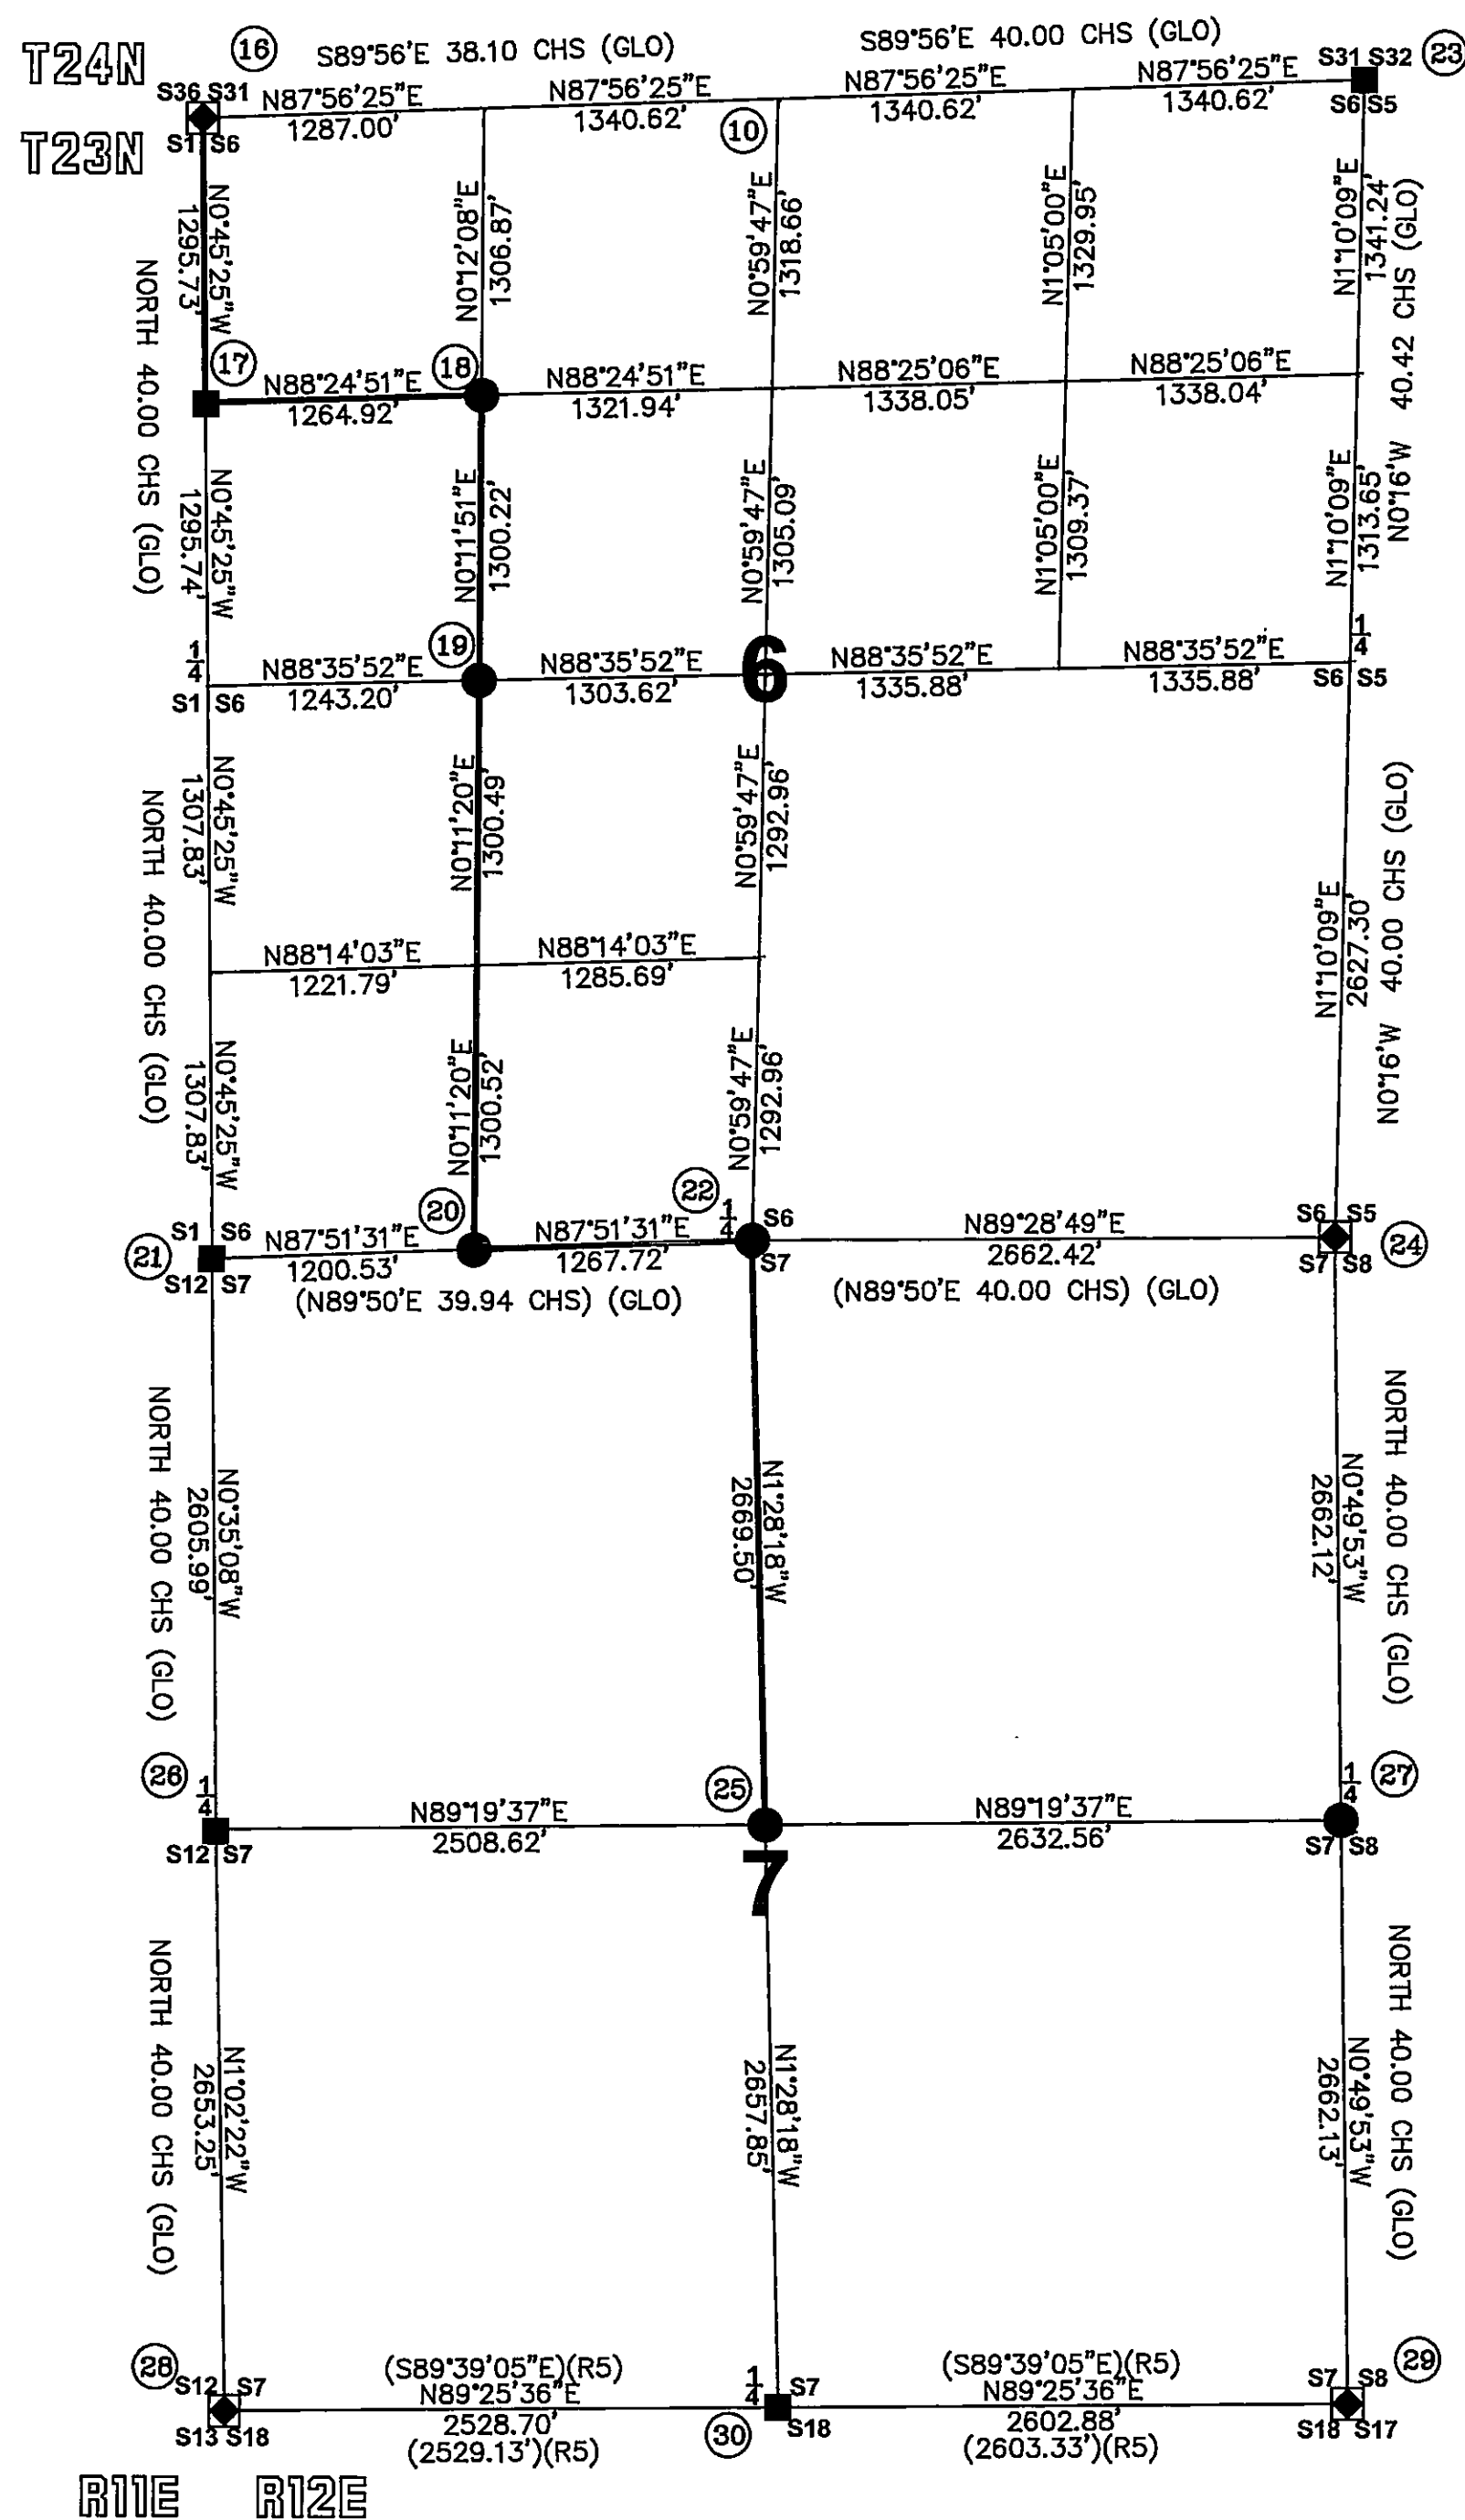

1983 STATE PLANE COORDINATES FOR S6 & S7 CORNERS

CORNER NO.	NORTHING	EASTING
16	1847583.254	6931078.955
17	1846287.635	6931096.075
18	1846322.643	6932360.507
19	1845022.434	6932356.022
20	1842421.444	6932347.451
21	1842376.585	6931147.755
22	1842468.814	6933614.286
23	1847774.055	6936384.381
24	1842492.963	6936276.597
25	1839800.199	6933682.840
26	1839770.730	6931174.390
27	1839831.125	6936315.220
28	1837117.917	6931222.522
29	1837169.275	6936353.843
30	1837143.225	6933751.095

LEGEND

- ◆ FOUND BLM CORNER
- ├ CALCULATED CORNER
- ⑩ CORNER NOTE
- SET STANDARD U.S. FOREST SERVICE DRIVE-IN MONUMENT (BEARING TREES AS NOTED)
- PROPERTY BOUNDARY MARKED AND POSTED
- FD CORNER AS NOTED


(R5) 10RS74

GENERAL NOTES

A STANDARD UNITED STATES FOREST SERVICE (USFS) DRIVE-IN MONUMENT IS A 5/8" DIAMETER ALUMINUM ROD WITH A 3-1/4" ALUMINUM CAP EDGE-MARKED WITH THE USFS LOGO.

A STANDARD BUREAU OF LAND MANAGEMENT (BLM) MONUMENT IS A 2-1/2" DIAMETER STEEL PIPE, 28" LONG WITH A 3-1/2" BRASS CAP EDGE-MARKED WITH THE BLM LOGO.

ALL BLM CORNERS USED ON THIS SURVEY WERE VERIFIED AND ACCEPTED BY ME, HOWEVER, THE BLM BEARING TREES WERE NOT TIED BUT WERE CHECKED IN THE FIELD.

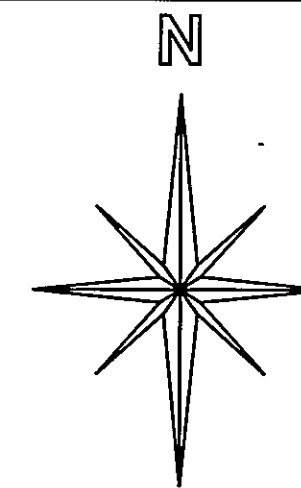

SCALE

1" = 800 FEET



BASIS OF BEARINGS

MEASURED BEARINGS AND DISTANCES ARE GRID BASED ON THE CALIFORNIA COORDINATE SYSTEM OF 1983 (CCS83), ZONE 1.

θ AT THE SE CORNER OF SECTION 11 IS 0°50'54" TO GET TO TRUE NORTH ROTATE TO RIGHT 0°50'54" MULTIPLY GRID DISTANCES BY .9998356477 TO GET GROUND DISTANCES.

CONTROL WAS ESTABLISHED WITH G.P.S., TOPCON HIPER, DUAL FREQUENCY. CONTROL WAS ESTABLISHED USING THE FOLLOWING STATIONS:

"HPGN CA 02 27" (KS2012) (EPOCH DATE 2007)
LATITUDE: 39°51'14.41797" N 1832871.45 N
LONGITUDE: 120°41'06.41349" W 6930833.08 E

"QUINCY NCMN RM 3" (AE2770) (EPOCH 2007)
LATITUDE: 39°58'29.74784" N 1875934.67 N
LONGITUDE: 120°56'40.40623" W 6857465.53 E

LATITUDES AND LONGITUDES AS PUBLISHED BY NATIONAL GEODETIC SURVEYS (NGS) IN JANUARY 17, 2011

SHEET INDEX

SECTION 11 T23NR11E MDM	1 OF 11
SECTION 6 & 7 T23NR12E MDM	2 OF 11
SECTION 2 T22NR11E MDM	3 OF 11
SECTION 12 T23NR11E MDM	4 OF 11
SECTION 27 & 26 T23NR11E MDM	5 OF 11
SECTION 10 T23NR11E MDM	6 OF 11
CORNER NOTES S11	7 OF 11
CORNER NOTES S6 S7 S12 S2	8 OF 11
CORNER NOTES S27 S26	9 OF 11
CORNER NOTES S10	10 OF 11
BLM FIELD NOTES S27 S26	11 OF 11

DGA&V LAND SURVEYOR'S

11448 SMITH RD.
MARYSVILLE, CA. 95901
530-671-6375

BILL SNOW 775-787-8420

RECORD OF SURVEY

SECTIONS 6 & 7, T23N R12E, MDM
PLUMAS COUNTY, CALIFORNIA

FOR

U.S.D.A. PLUMAS NATIONAL FOREST
159 LAWRENCE ST
QUINCY, CA. 95971

DRAWN BY: B. SNOW DATE: DECEMBER, 2011 SHEET 2 OF 11