


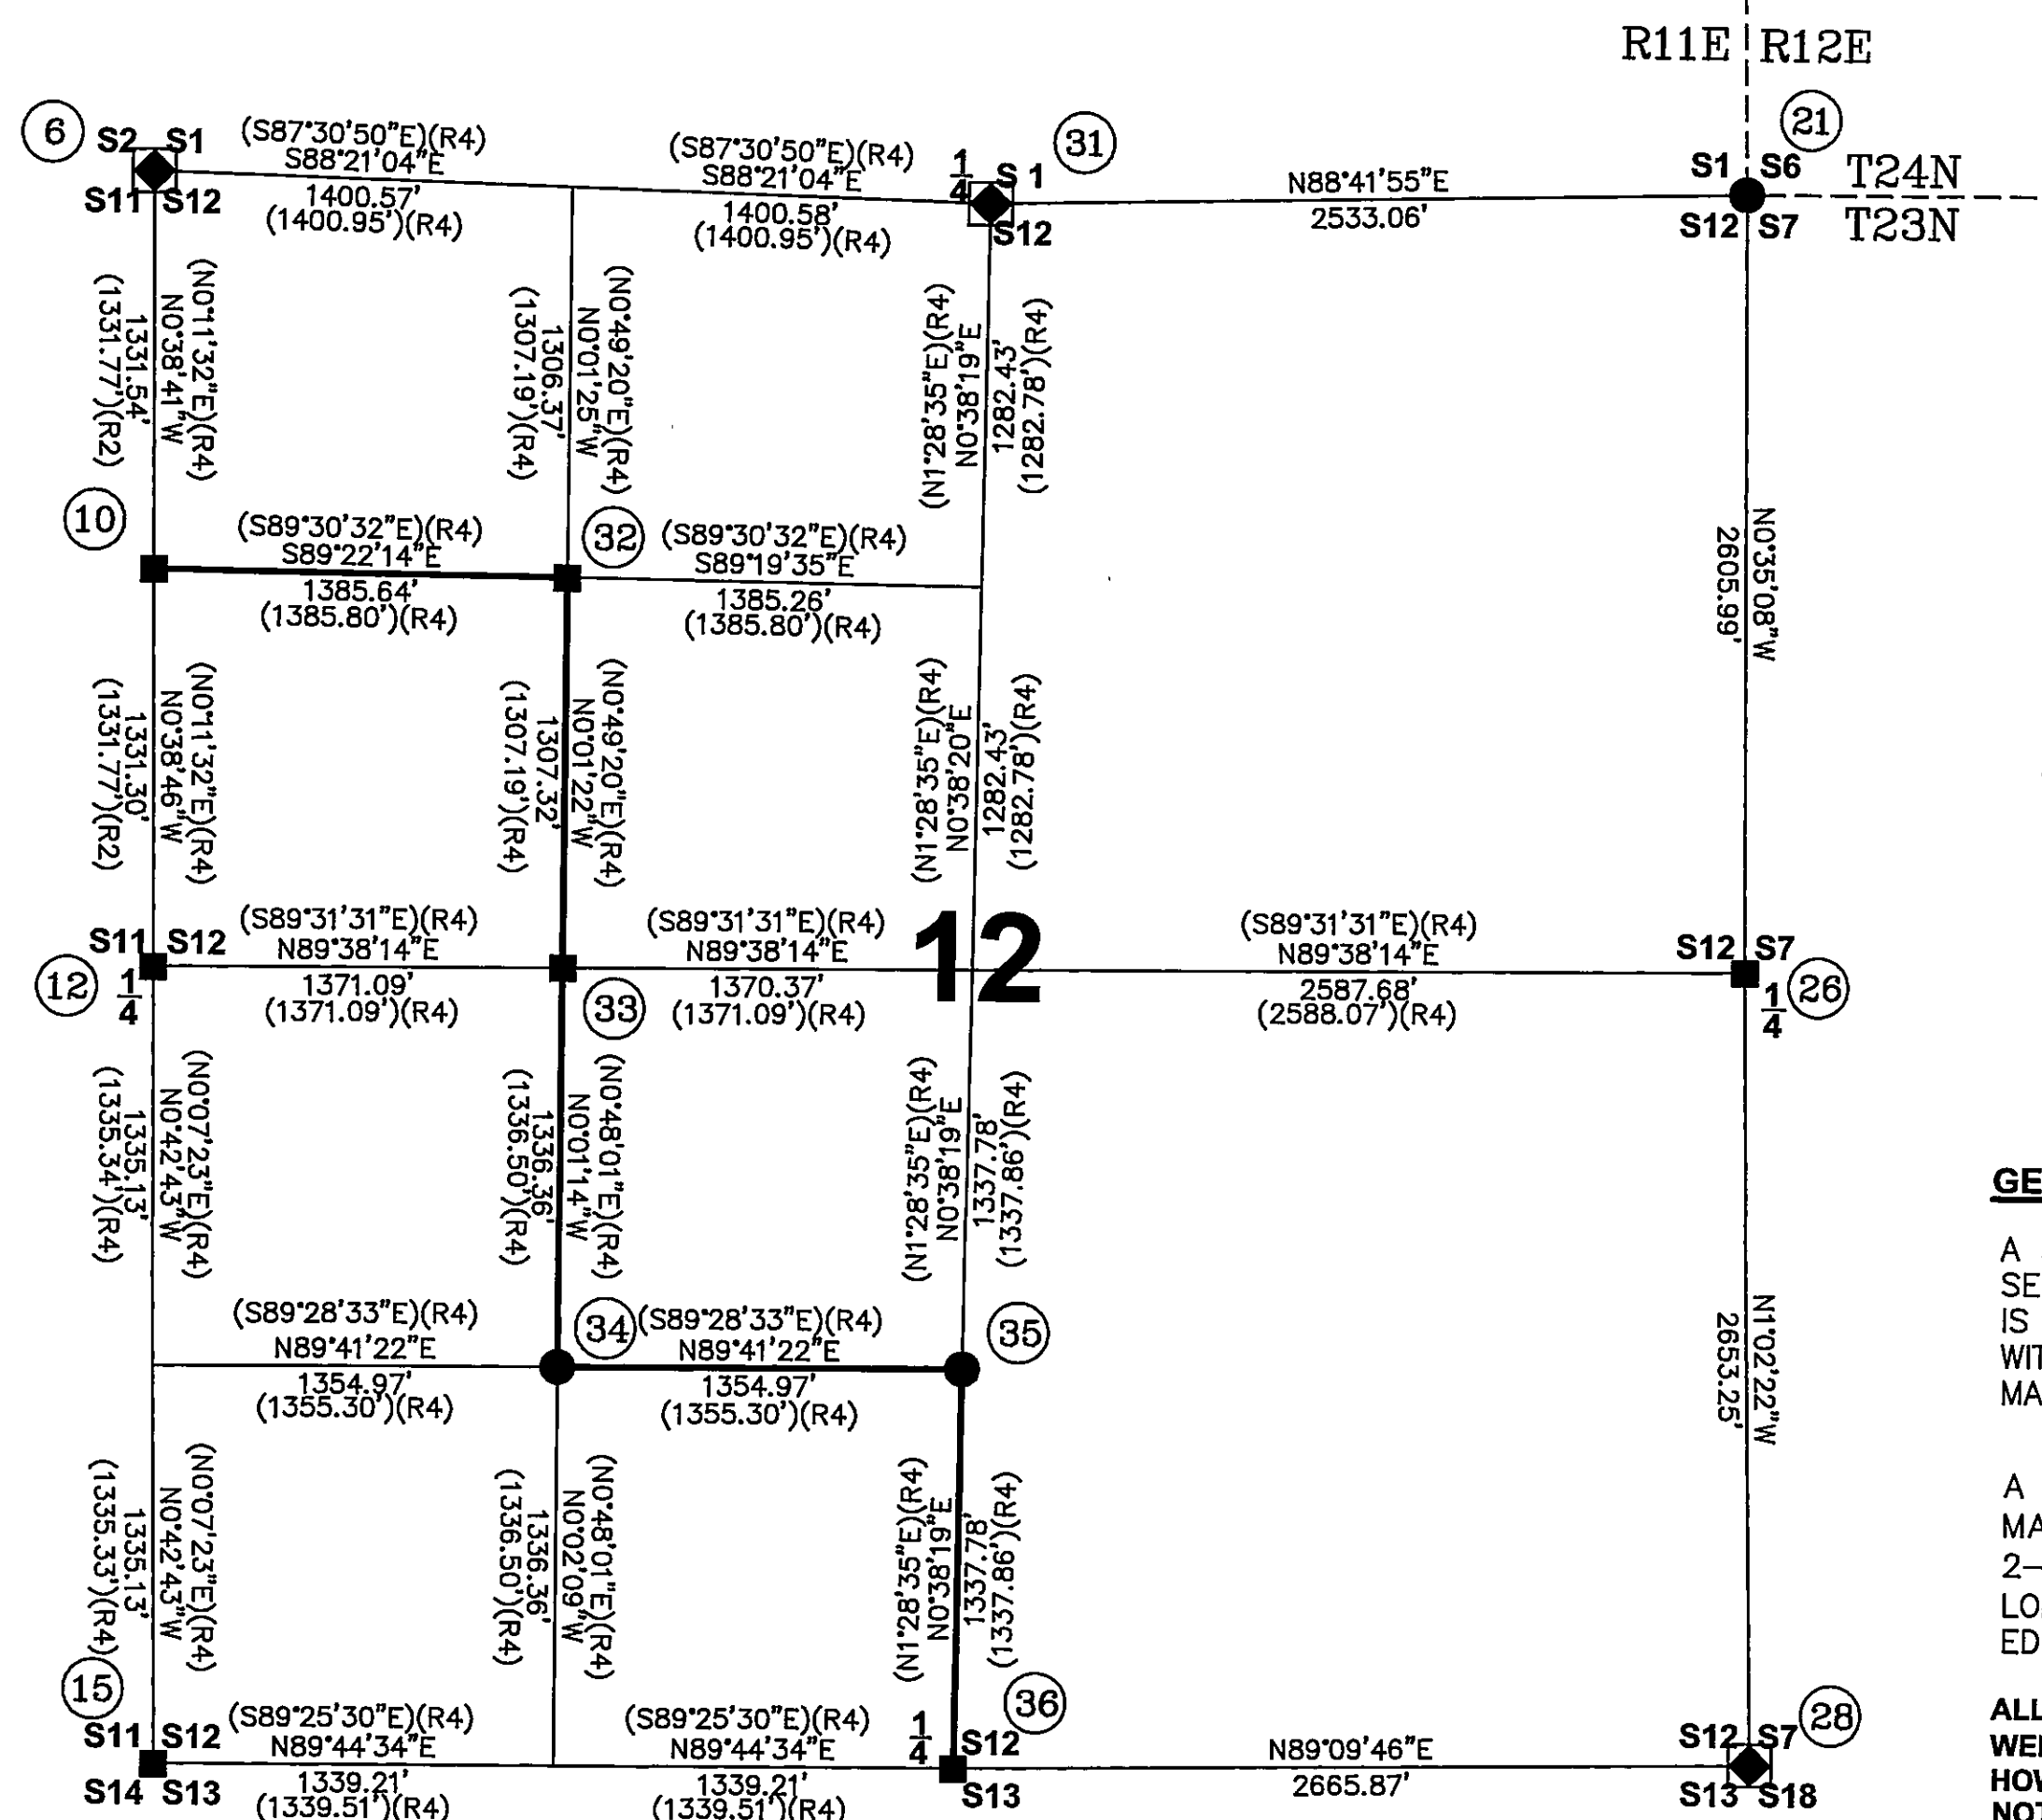


- ◆ FOUND BLM CORNER
- ├ CALCULATED CORNER
- ⑩ CORNER NOTE
- SET STANDARD U.S. FOREST SERVICE DRIVE-IN MONUMENT (BEARING TREES AS NOTED)
- PROPERTY BOUNDARY MARKED AND POSTED
- FD CORNER AS NOTED
- (R2) 10PM97
- (R4) 13RS29

GENERAL NOTES

A STANDARD UNITED STATES FOREST SERVICE (USFS) DRIVE-IN MONUMENT IS A 5/8" DIAMETER ALUMINUM ROD WITH A 3-1/4" ALUMINUM CAP EDGE-MARKED WITH THE USFS LOGO.

A STANDARD BUREAU OF LAND MANAGEMENT (BLM) MONUMENT IS A 2-1/2" DIAMETER STEEL PIPE, 28" LONG WITH A 3-1/2" BRASS CAP EDGE-MARKED WITH THE BLM LOGO.

ALL BLM CORNERS USED ON THIS SURVEY WERE VERIFIED AND ACCEPTED BY ME, HOWEVER, THE BLM BEARING TREES WERE NOT TIED BUT WERE CHECKED IN THE FIELD.

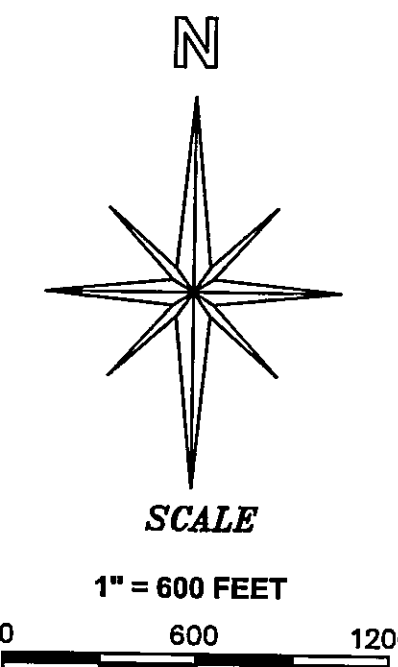

BASIS OF BEARINGS

MEASURED BEARINGS AND DISTANCES ARE GRID BASED ON THE CALIFORNIA COORDINATE SYSTEM OF 1983 (CCS83), ZONE 1.

θ AT THE SE CORNER OF SECTION 11 IS 0°50'54" TO GET TO TRUE NORTH ROTATE TO RIGHT 0°50'54" MULTIPLY GRID DISTANCES BY .9998356477 TO GET GROUND DISTANCES.

CONTROL WAS ESTABLISHED WITH G.P.S., TOPCON HIPER, DUAL FREQUENCY. CONTROL WAS ESTABLISHED USING THE FOLLOWING STATIONS:

"HPGN CA 02 27" (KS2012) (EPOCH DATE 2007)
 LATITUDE: 39°51'14.41797" N 1832871.45 N
 LONGITUDE: 120°41'06.41349" W 6930833.08 E

"QUINCY NCMN RM 3" (AE2770) (EPOCH 2007)
 LATITUDE: 39°58'29.74784" N 1875934.67 N
 LONGITUDE: 120°56'40.40623" W 6857465.53 E

LATITUDES AND LONGITUDES AS PUBLISHED BY NATIONAL GEODETIC SURVEYS (NGS) IN JANUARY 17, 2011

1983 STATE PLANE COORIDATES FOR S6 & S7 CORNERS

CORNER NO.	NORTHING	EASTING
6	1842399.660	6925815.361
10	1841068.209	6925830.343
12	1839736.989	6925845.355
15	1837066.938	6925878.535
16	1842319.056	6928615.352
17	1842376.585	6931147.755
18	1841052.987	6927215.895
19	1839745.672	6927216.417
20	1839770.730	6931174.390
21	1838409.308	6927216.896
22	1838416.652	6928571.846
23	1837078.958	6928556.933
24	1837117.917	6931222.522

SHEET INDEX

SECTION 11 T23NR11E MDM.....	1 OF 11
SECTION 6 & 7 T23NR12E MDM.....	2 OF 11
SECTION 2 T22NR11E MDM.....	3 OF 11
SECTION 12 T23NR11E MDM.....	4 OF 11
SECTION 27 & 26 T23NR11E MDM.....	5 OF 11
SECTION 10 T23NR11E MDM.....	6 OF 11
CORNER NOTES S11.....	7 OF 11
CORNER NOTES S6 S7 S12 S2.....	8 OF 11
CORNER NOTES S27 S26.....	9 OF 11
CORNER NOTES S10.....	10 OF 11
BLM FIELD NOTES S27 S26.....	11 OF 11

DGA&V LAND SURVEYOR'S
11448 SMITH RD.
MARYSVILLE, CA. 95901
530-671-6375

BILL SNOW 775-787-8420

RECORD OF SURVEY
 SECTION 12, T23N R11E, MDM
 PLUMAS COUNTY, CALIFORNIA
 FOR
U.S.D.A. PLUMAS NATIONAL FOREST
159 LAWRENCE ST
QUINCY, CA. 95971

DRAWN BY: B. SNOW DATE: DECEMBER, 2011 SHEET 4 OF 11